
# Report of Archaeological Recording September - December 2003 1-3 Bridge Street, formerly Ashers Bakery, Nairn NH 8856 / 5661 (centred)

Client: Tulloch Homes Ltd

Planning Application No: 03/00037/FULNA

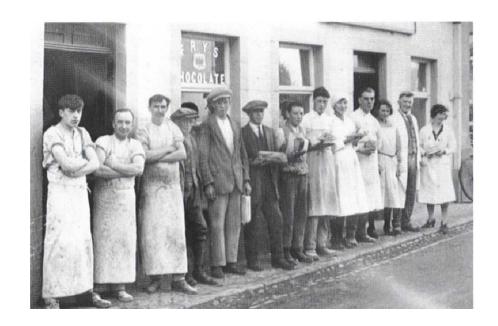

By Stuart Farrell B.A A.I.F.A F.S.A.Scot. December 2003

#### Contents

- 1. Introduction
- 2. Acknowledgements
- 3. Background
- 4. Objectives
- 5. Method
- 6. Results
- 7. Conclusions
- 8. Recommendations
- 9. Archive
- 10. Discovery and Excavation
- 11. References

Appendix 1 – Photographic Register

- 2 County Valuation Rolls
- 3 Census Returns

Cover – Staff outside Ashers Bakery 1919 (From Ellen, 1995, 14)

#### **Non-Technical Summary**

Stuart Farrell was commissioned by Tulloch Homes Ltd in August 2003 to undertake a project of archaeological recording at 1-3 Bridge Street, Nairn, formerly Asher's Bakery (NH 8856/5661) as part of a housing development. Highland Council Archaeology Unit produced a specification for this work.

Work revealed the existing buildings that were demolished to date from the early to mid 19<sup>th</sup> century with later additions and alterations up to the late 20<sup>th</sup> century. A monitoring of the demolition work revealed that most of the site had been heavily levelled possibly in the late 19<sup>th</sup> century and the 1950's and over recent years, therefore causing the removal of any archaeological deposits to most of the development location. Work to the east end of the site did reveal some garden soils but no dateable material earlier than the 18<sup>th</sup> century was found, though this area was again heavily disturbed by services and later buildings.

No recommendations for further work have been proposed.

#### 1. Introduction

This report is for a project of archaeological recording conducted on behalf of Tulloch Homes Ltd by the author for a housing development at 1-3 Bridge Street. Nairn.

The fieldwork was conducted between early September 2003 and December 6<sup>th</sup> 2003.

## 2. Acknowledgements

I would like to thank the following for their help during the work:

- Mr. D MacLean, site Agent for Tulloch Homes Ltd;
- Ms A MacRitchie, of Bracewell Stirling Architects;
- Mr. A Barron, of Nairn for photograph of shop before hoardings were put up.
- Mr. E Grant, Highland Council Area Planning, for help with planning history;
- Staff of W Munro Demolition for onsite works:
- Staff of Highland Council Archaeology Unit;
- Staff of the RCAHMS;
- Staff of the NMRS;
- Staff of Highland Council Archives.

Stuart Farrell 39a Park Street Nairn Highland IV12 4PP

Figure 1 – General Location 1: 25,000 – site circled

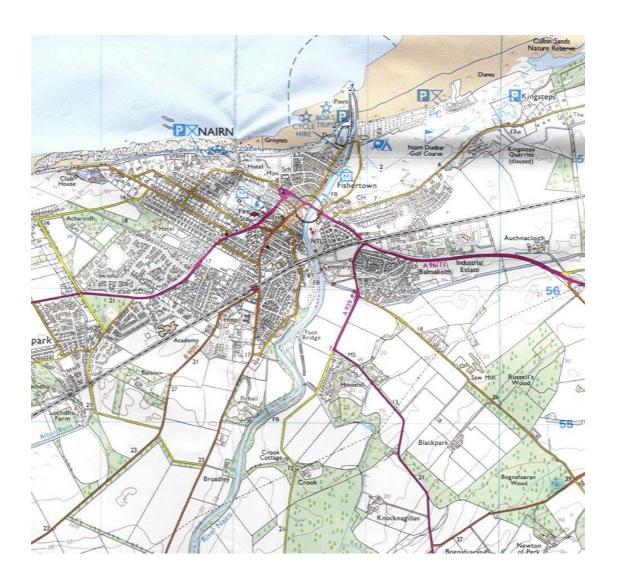


Figure 2 – Development Location 1:500



Figure 3 – John Wood's Plan of Nairn 1821

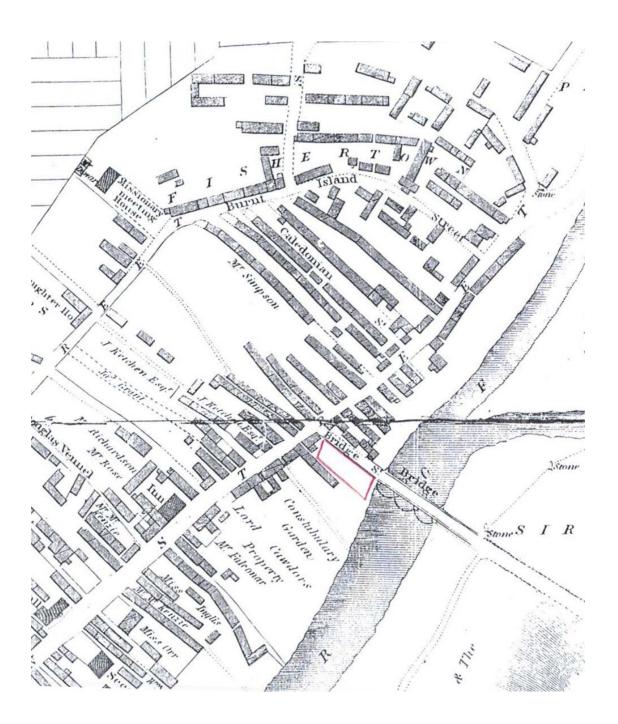


Figure 4 - Ordnance Survey Town plan of 1869 1:500



Figure 5 – 1<sup>st</sup> edition Ordnance Survey Map of 1871 (Enlarged from 1:2500)

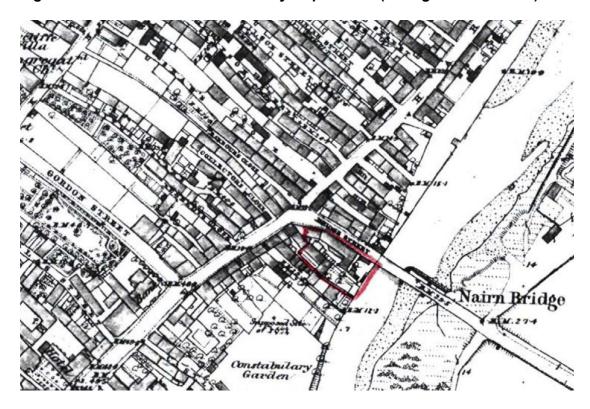


Figure 6 – Dallas' Map of Nairn no date (Enlarged from c1:2500)

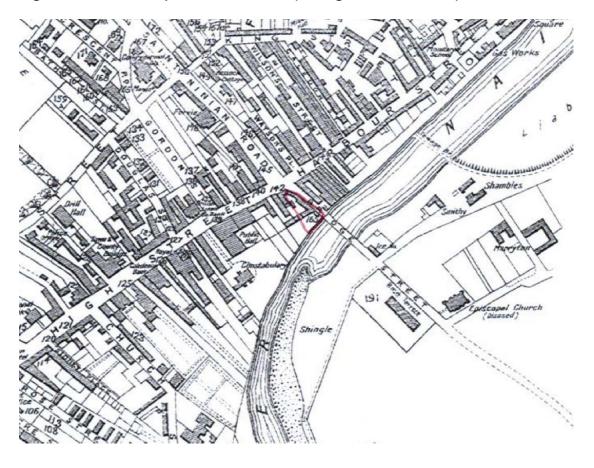


Figure 7 – Frasers' Map of Nairn no date (Enlarged from c1:2500)

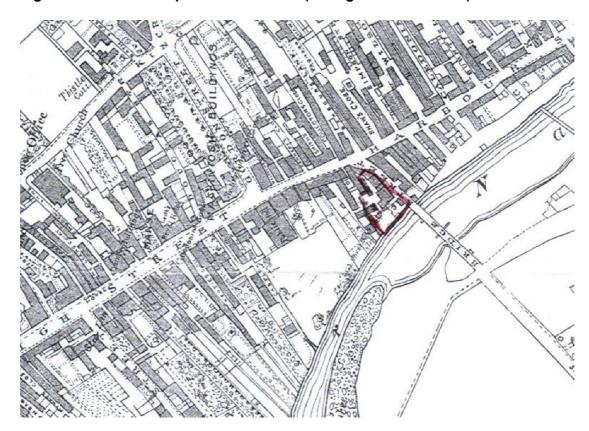


Figure 8 - 2<sup>nd</sup> edition Ordnance Survey Map of 1905 (Enlarged from 1:2500)

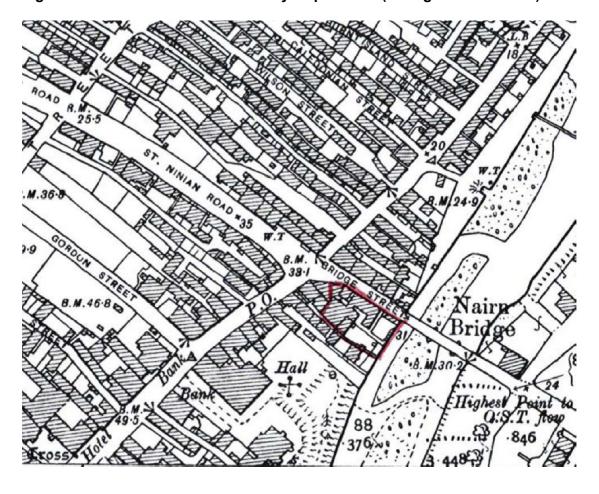


Figure 9 - Ordnance Survey Map of 1964 (Enlarged from 1:2500) © Crown Copyright - Licence 100041016

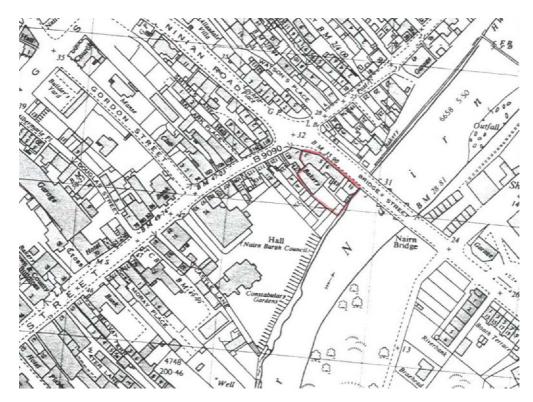


Figure 10 - Ordnance Survey Map of 1972 (Enlarged from 1:2500) © Crown Copyright – Licence 100041016

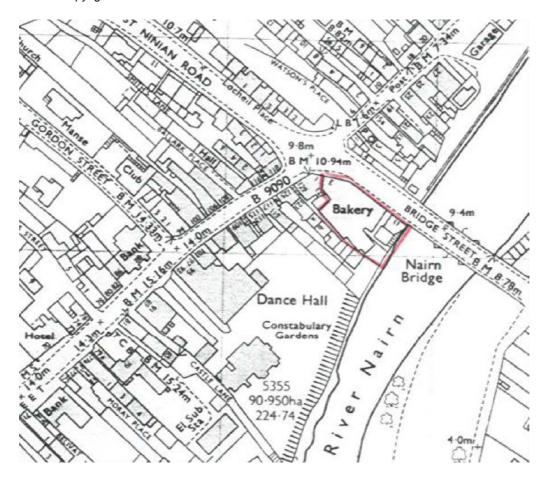


Figure 11 - View from railway Viaduct c1890. ⊚ RCAHMS



**Figure 12 –** View from railway Viaduct early 20<sup>th</sup> century



Figure 13 – View West from East side of River circa 1931 (From Barron, 1999, 4)

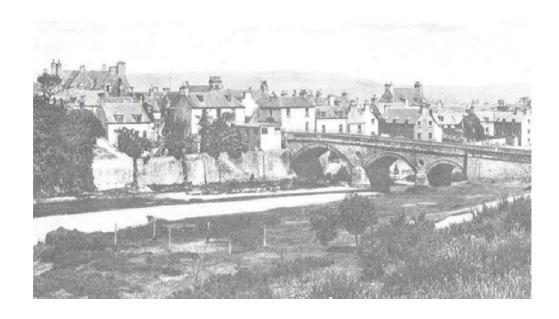


Figure 14 – Aerial photograph of Nairn Bridge Street circa 1931 (From Ellen, 1999, 9)

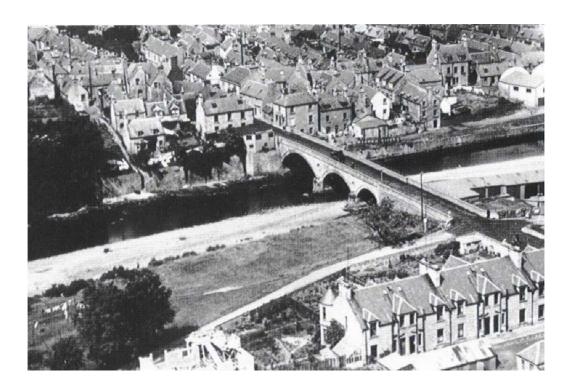


Figure 15 - View east along Bridge Street circa 1935 (From Ellen, 1999, 15)



Figure 16 - View of Nairn by William Daniell of 1821 (From Ellen, 1999, 5)

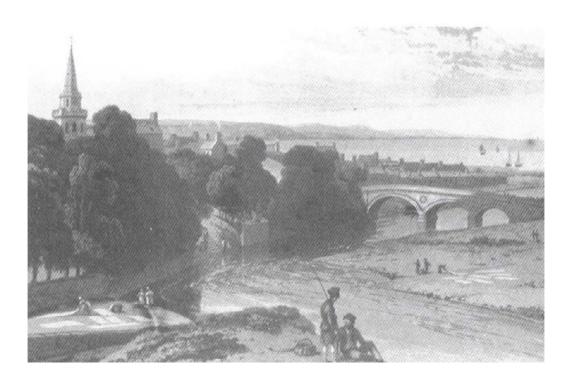


Figure 17 – Existing Ground Plan 1953 scale 1/8"- 1ft.



Figure 18 – Existing 1<sup>st</sup> Floor Plan 1953 scale 1/8"- 1ft.

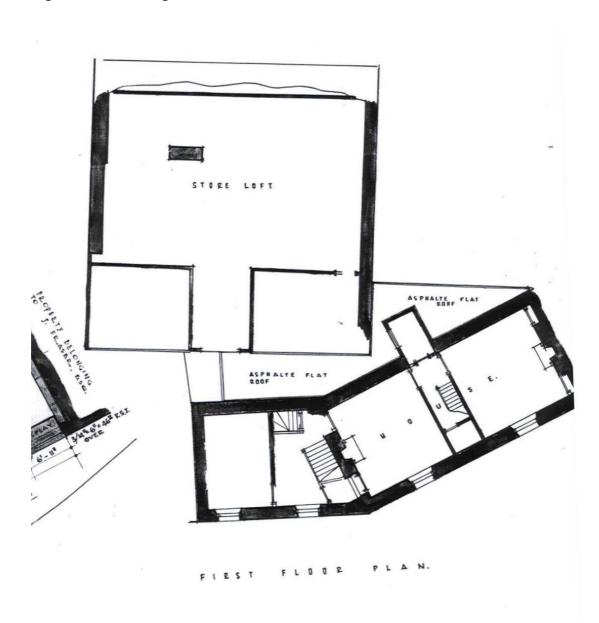


Figure 19 – Proposed Ground Plan 1953 scale 1/8"- 1ft.

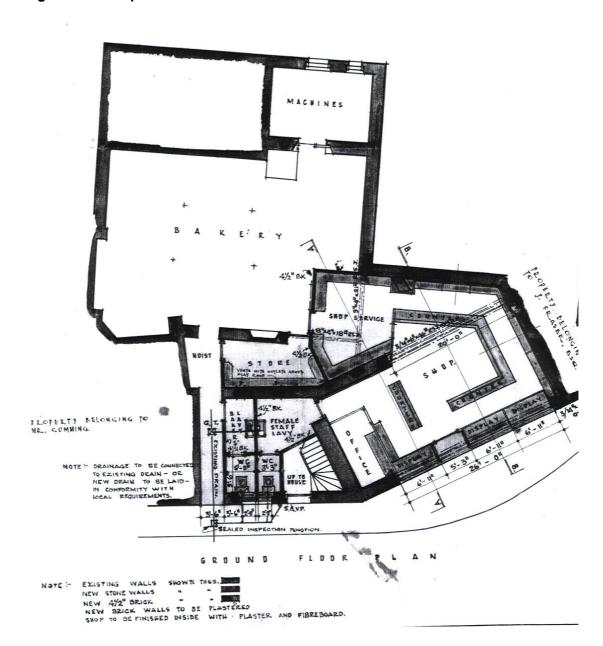


Figure 20 – Front Elevation 1953 scale 1/8"- 1ft.

FRONT ELEVATION FROM 'A'

Figure 21 – New Front Elevation 1953 scale 1/8"- 1ft.

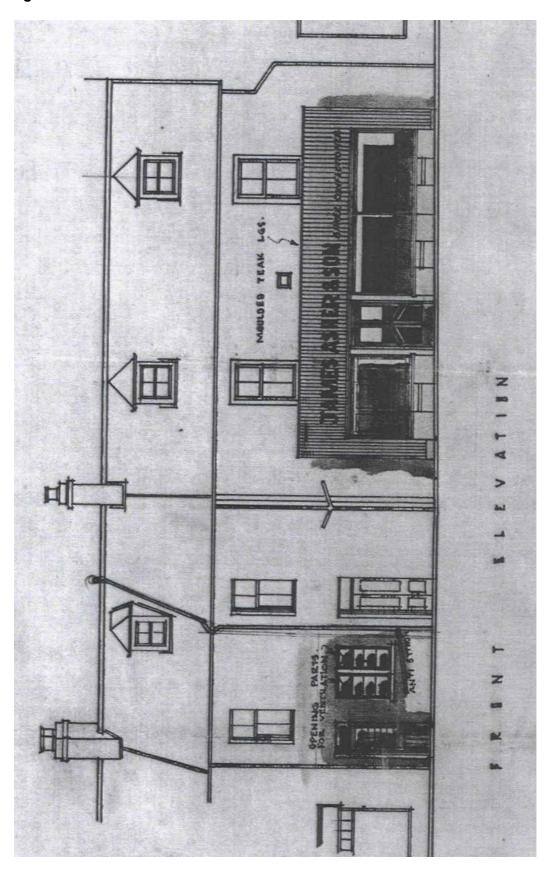


Figure 22 – Ground Plan of Bakery 1960 scale 1/8"- 1ft.

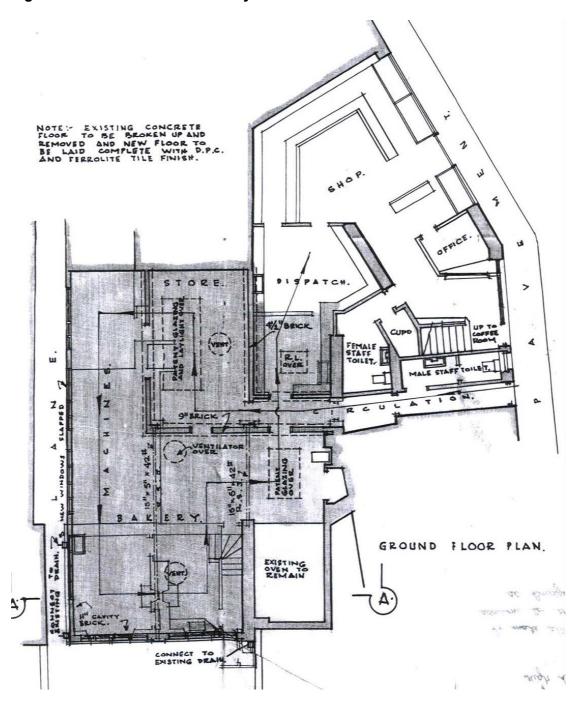


Figure 23 – Roof Plan of Bakery 1960 scale 1/8"- 1ft.

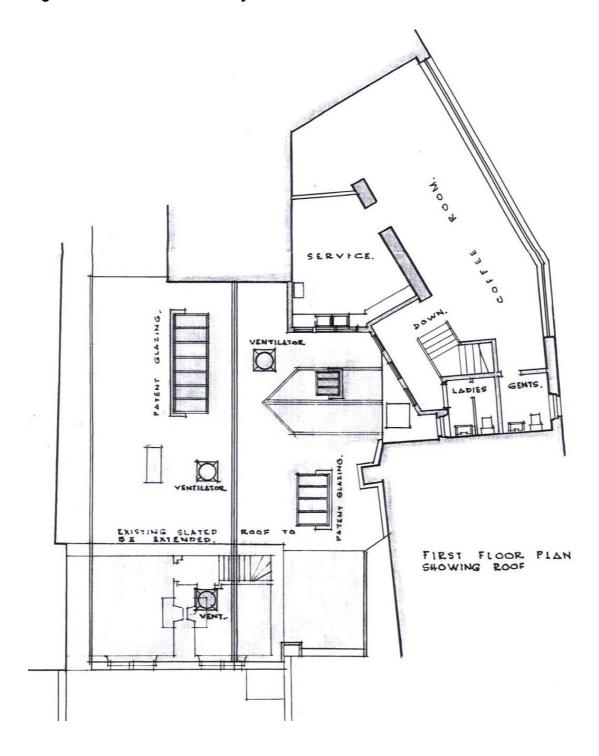


Figure 24 – South Elevation of Bakery 1960 scale 1/8"- 1ft.

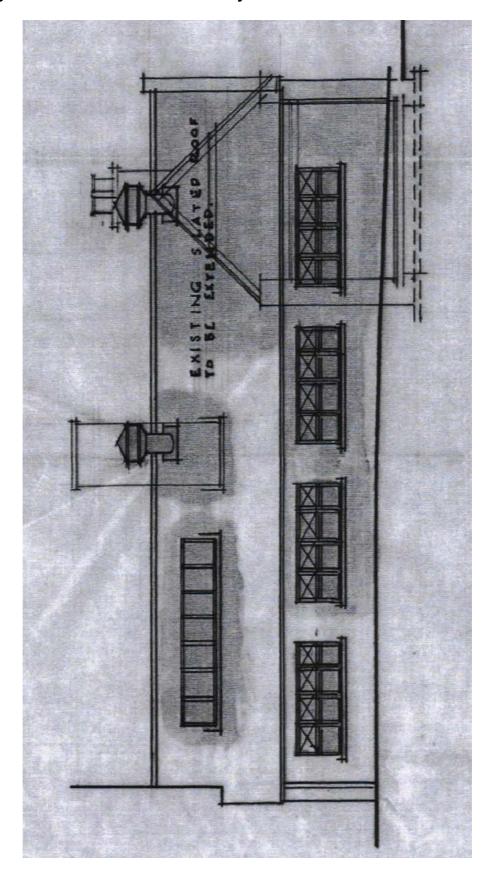


Figure 25 – Sketch Plan of Building to NE Corner - Not to scale With Numbered photograph locations.


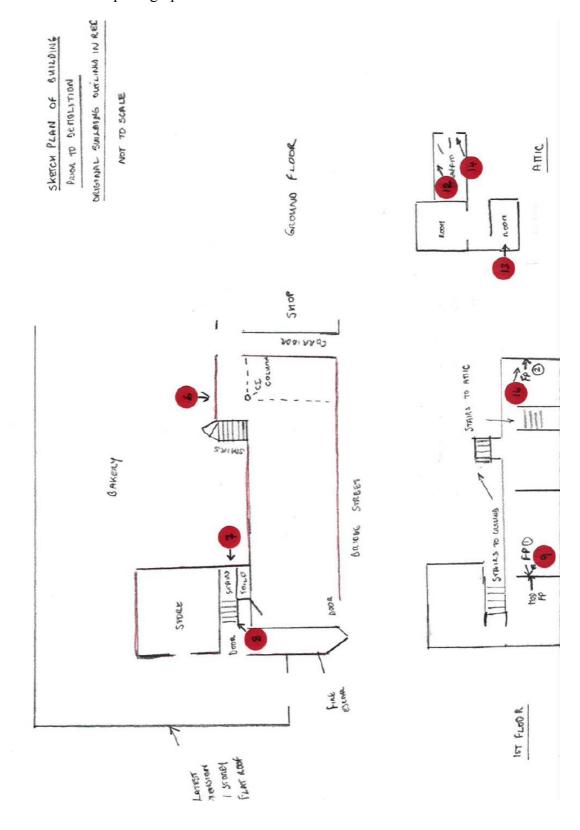


Figure 26 - Plan of Site 1: 500

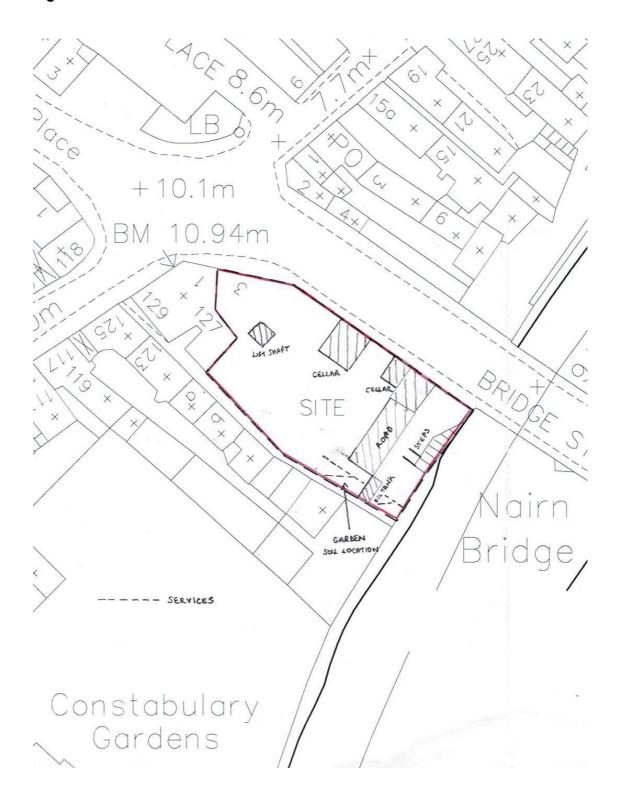

 $\begin{array}{lll} \mbox{Photo 1-Top -} & \mbox{View of shop } \mbox{\o} \mbox{ A Barron September 2003.} \\ \mbox{Photo 2-Middle -} & \mbox{View of shop facing S.} \\ \mbox{Photo 3-Bottom -} & \mbox{View of shop facing southwest.} \end{array}$ 







Photo 4 – View of east range of buildings facing W. Photo 5 – View of steps down to river. Photo 6 – View of oven in Bakery.







Photo 7 – View of oven in Bakery. Photo 8 – Detail of cast-iron banisters. Photo 9 – View of removed fireplace 1<sup>st</sup> floor – scale 1m.





Photo 10 – Detail of stairs to 1<sup>st</sup> floor. Photo 11 – View of 1<sup>st</sup> floor above shop facing E. Photo 12 – Detail of graffiti on wall.





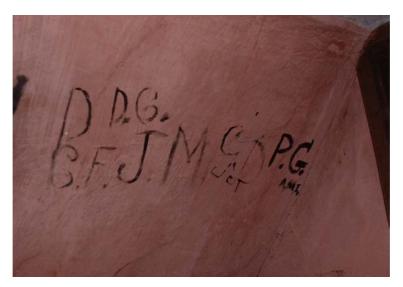


Photo 13 – View of attic room 1<sup>st</sup> floor. Photo 14 – Detail of graffiti on door. Photo 15 – View of east range facing N.





Photo 16 – Detail of fireplace revealed 1<sup>st</sup> floor – scale 1m. Photo 17 – View of demolition in progress – removal of concrete facing east. Photo 18 – View of site facing west upon site clearance.







Photo 19 – View of garden soils to south side of site.

Photo 20 – View of natural ground to NE corner of site facing north.

Photo 21 – Detail of trench to south showing garden soils on natural – scales 1m.







#### 3. Historical Background

The Royal burgh of Nairn (originally named Invernairn) was established possibly in the late 12<sup>th</sup> century though the town as known today may be a later 13<sup>th</sup>/14<sup>th</sup> century layout as the original site of the town may lie in the Moray Firth. The Castle of Nairn dates to William the Lion (1165-1214) though was burnt down during the Wars of Independence (1306-29) though recorded to still be in a ruined existence in the 16<sup>th</sup> century.

The Castle probably stood at Constabulary Gardens to the south with two fords across the river: one at the north end of the High Street below the bridge, the 2<sup>nd</sup> by the church. There is a reference possibly of a bridge in the 13<sup>th</sup> century (Dennison & Coleman, 1999, 18) of a burgess named 'Adam of the bridge' though this could be a reference to a drawbridge at the castle. Nairns' status of a Royal Burgh was confirmed by charter of James VI in October 1589 and ratified by parliament in 1661. No mention of ports into the town, though they may have been located at each end of the High Street (Dennison & Coleman, 1999, 20). A bridge across the River Nairn is recorded to have been built in 1631 and repaired in 1707, 1719 and 1770 and swept away by floods in 1782. A new bridge was built in 1803-4, repaired extensively in 1829 when flooding again removed stone bulwarks on the town side of the bridge and caused extensive flooding in the town (Bain, 1903, 558) and being widened in

#### Cartographic History

1936-7.

The earliest town plan of Nairn is John Wood's plan of 1821 (see figure 3) where nothing is depicted to the development location (not even the nearby ford crossing). By the Ordnance Survey town plan of 1869 (see figure 4) a L-shaped building fronting Bridge Street with a number of smaller structures to the rear and E of the building is depicted. To the south is marked a rectangular building named as 'Bristol Cottage' with a set of steps to the river edge. The 1<sup>st</sup> edition of 1874 (see figure 5) shows the same features at a smaller scale.

Two maps of the town to the late 19<sup>th</sup> century include Dallas's (see figure 6) show the L shaped range but not Bristol Cottage, although numbered 165 a key in not available. Fraser's map of Nairn (see figure 7) shows the L- shaped range to possibly be of 4 buildings with Bristol Cottage to the south with a number of small structures east by the river.

By the 2<sup>nd</sup> edition Ordnance Survey of 1905 (see figure 8) an addition has been made to the rear of the L shaped building, a new building fronts Bridge Street. By the Ordnance Survey of 1964 (see figure 9) the site is comprised of 4 buildings marked 3-13 with bakery to rear, and building to E by bridge numbered 11 with open ground to the SE corner. By the latest Ordnance Survey plan of 1972 (see figure 10) the site is depicted as one building marked bakery with 11 Bridge Street to E.

#### Photographs & Prints

Photographs of this area of the town of Nairn are both lacking locally and nationally, with only a few existing views.

Of two views of the river, one from circa 1880 (see figure 11) shows open ground to the east that by the early 20<sup>th</sup> century (see figure 12) a flat roofed building is visible by the river edge. This building is more clearly visible on photograph of circa 1931 (see figure 13) and on an aerial photograph of the same period (see figure 14). Views of the front of the shop are very scarce with one view from 1935 (see figure 15) of the shop front that was unchanged until the 1950's; this view of

the building from a group photograph of 1919 (see front cover) seems also to have been unchanged.

Prior to this view's of the river of Nairn are very rare, William Daniels' print of 1821 shows trees to the area of the bakery and shows an access to the river (possibly for a ford) to the south of the development area. (This path is also visible on the aerial photograph of 1931 and still visible today)

#### Planning History

Unfortunately records of planning history to the site are lacking. Though some details are held in the Nairn Area Planning Office of Highland Council; plans are often missing or lost.

A list in the Dean of Guild Register notes that James Asher made alterations to the shop in 1910 of a new shop front but no details or plans are available. (No records are available before this date).

Drawings are available for major alterations conducted in 1953 (see figures 17-21) when the existing house above the bakery shop was converted into a coffee shop and the frontage of the shop was altered to an open shop front with large plate glass windows. Internally the building was altered to the removal of stores and the creation of toilets and office space. It is interesting to note that the shop front seems to have been unchanged from the photograph of 1919 (see cover) and that the new frontage remained the same until the shop closed (compare with photograph 1).

Recorded in 1957 that permission was given to alter and extend the building of no's 3 & 5 Bridge Street but no drawings are available.

Drawings are again available for alterations made to the bakery roof in 1960 (see figures 22-24) where the roofline was raised and new concrete floors constructed noting the removal of the existing floors.

Recorded in 1976 that permission was given to change dwelling to store (this is probably the building to the east formerly Cumming's shop or 9 Bridge Street forming the NE corner of the L shaped building) but again no drawings are available.

Recorded in 1978 that permission was given for a single storey extension to the east side of the building with the removal of no.11 Bridge Street, but again no drawings are available.

There are no planning records for 9 or 11 Bridge Street. (See OS map of 1964 – figure 9).

## **Building History**

Site is not listed in either the Highland Sites and Monuments Record or the National Monuments Record of Scotland, Edinburgh. Site not noted by Gifford (1992) or by Bain (1903). A study of the County Valuation Rolls (see appendix 2) and Census returns (see appendix 3) proved difficult since some houses were renumbered and that the early Valuation Rolls are listed alphabetically by occupier rather than by address and with early census returns having no house numbers.

What can be noted is that the bakery premises were under the tenancy of an Ann McGlashan in 1860 until 1866 when Donald Grant had a bakery business at Bridge Street and they became James Asher's in 1879. He bought the adjoining properties of no's 5 & 7 Bridge Street within the next few years. These were formerly a saddler's and a flesher's.

Prior to this there is no house numbers in the Census Returns for 1841 and 1851 and only 3 houses are recorded to Bridge Street none of which is a bakery.

## **Summary**

The buildings to the development area have seen vast changes, particularly in use and physically in additions and alterations many of which details are not available either in plan or documental evidence. The site by lying close to the bridge of Nairn has also possible seen extensive flooding. Surviving archaeological deposits may therefore be limited.

#### 4. Objectives

To conduct a recording project prior to and during the development to record those features revealed by excavation work. A copy of the specification provided by Highland Council Archaeology Unit is enclosed.

#### 5. Methodology

The following work was undertaken as part of the project:

- Desk based assessment
- Photographic survey of building prior to demolition
- Watching brief maintained during demolition
- Trial Trenching
- Monitoring of ground works.

#### 6. Results

The archaeological recording was carried out in accordance with accepted professional archaeological standards as published by the Institute of Field Archaeologists (IFA 1999). Over the construction period a suitably qualified archaeologist was on site to carry out observations and assessment of the area affected by the development works.

## Site Location

The sites on the west side of the River Nairn and to the north of the High Street.

#### **Existing Building**

The existing north facing building is 2-storey (see photographs 1-3) slated with double glazed smoked windows to ground and 1<sup>st</sup> floor with shop entrance on ground floor. With attic window to NE corner, with cast-iron guttering and down pipes. Moulded cornicing above former window frontage along Bridge Street. The east elevation also of 2-storey with 2 attic rooms (see photographs 4 and 15) with later flat roof extension with sash and case windows. To the east by the riverside is a set of disused steps (see photograph 5).

Internally the ground plan of the bakery is almost unchanged since 1960 (see figures 22 and 25) with the bakery to the rear of the building. Area marked as store on figure 22 is a walk-in refrigeration unit; ovens still insitu with 1 in same position as marked on figure 22 (see photograph 6 for 2<sup>nd</sup> see photograph 7) with entrance along corridor to Bridge Street. Shop on ground floor extended with removal of office to form coffee shop, with modern lift shaft in area of dispatch (this was because 1<sup>st</sup> floor changed recently to form bakery preparation area). Toilets in same place as depicted on plans. Former shop to NE (see figure 25) used as storage and delivery area. Shop to NE corner has cast-iron columns and panelled staircase to 1<sup>st</sup> floor. A rear stair (see photograph 8) also led to the 1<sup>st</sup> floor and attic rooms.

On the 1<sup>st</sup> floor above shop, former coffee shop (see figure 23) was changed to form preparation area with the installation of plastic melamine walling (see photograph 11) though the staircase from the refurbishment in the 1950's was

still extent (see photograph 10). Rooms on 1<sup>st</sup> floor to NE being used as offices and changing rooms, with mixture of both modern and old fittings including modern chip-board counters and modern light fittings. One fireplace was removed prior to photographic survey taking place (see photograph 9). Loft area to the rear of the bakery (as depicted on figure 18) used as store for packaging materials and disused equipment. Attic spaces above NE corner are former bedrooms (with mixture of wallpapers, cupboard by door - in NE room - and blocked up fireplace in room to NE corner (see photograph 13). Some graffiti of initials found in attic room to south (see photographs 12 and 14). All rooms recently used for storage of disused bakery equipment and crockery from former coffee shop.

Overall little original features of interest were visible in the building possibly due to the number of modern alterations taking place.

#### **Demolition Results**

Visits made during initial demolition work especially in the removal of walls and internal fittings revealed not much on the ground floor, with most of the walls around the shop front heavily rebuilt with concrete blocks. To the 1<sup>st</sup> floor above the shop (see figure 25) was revealed a former living room with a moulded wrought-iron fireplace, though the surround had been removed previously (see photograph 16) with doorway on south side of a former recessed cupboard. Walls decorated with flowered lily wallpaper over lathe and plaster walls. In the west gable of the former coffee shop was revealed a blocked up fireplace (infilled with concrete block), with the walls around the modern lift shaft all rebuilt in modern concrete brick.

Work upon the removal of the bakery to the rear, revealed a former rear doorway and chimney block of brick with modern cement pointing (where recess is marked on figure 22) in area of oven no.2. The rear of the original building had seen a number of alterations with guttering replaced with plastic pipes and additions of flat-asphalted roofs. Bakery to south side of site as depicted on figure 24 with metal-framed skylights and windows.

Removal of the concrete floor to an average depth of 110mm, though in certain areas especially along the south wall this deepened to 160mm (see photograph 17) revealed natural yellow-brown sand below over most of the site, especially to the bakery and shop areas. Work also revealed 2 cellars (see figure 26) the largest of these was 2.3m deep the other 1.4m deep. Work to the east end of the buildings (in the area of flat roofed single storey extension) revealed a reinforced concrete foundation situated above a former access road of tarmac and an oil storage tank (see figure 26). This later reinforced concrete was raised almost 0.7m so that floor level was same as existing street level. In some areas of the site, especially under the ovens and the refrigeration unit, there was polystyrene insulation under the concrete atop the natural sand. (Noted on drawing of 1960 – see figure 22 – that existing concrete floors were to be lifted and replaced). Removal of the sandstone at the shop front revealed that it was modern in date with concrete under the sandstone with no indication of any earlier frontage.

Discussions with Highland Council Archaeology Unit (Telephone call of 27-11-03) involved that trial trenching would not be viable as per the required of the specification of work due to the amount of the site that had been already cleared by previous development with the majority of the site being only natural sand (see photograph 18). Work to continue as a watching brief.

#### Watching brief Results

Removal of the reinforced concrete and tarmac to the east end of the site revealed a small deposit of garden soil to the south edge of the site with finds of bone, shell (oyster and mussel) and post-medieval/modern glass and some white glazed pottery. This possible early garden soil was light brown in colour to a depth of an average of 300mm and underlay black topsoil. Removal of part of the retaining wall to the south edge of site revealed that these dark soils were up to 0.8m higher than the natural sand. To the north edge of the site under the tarmac (see photograph 20) natural sand was revealed to run in a slope towards the south on a gradual decline.

A single trench 1.2m wide and 8m in length (though this was divided by a concrete foundation for the road) was made through this garden soil (see photograph 21) in the area of proposed foundation trench along the southern edge of the site. This revealed that the garden soil was heavily cut with services (see figure 26) and was on a steep slope eastwards towards the river (see section in photograph 21). There was no indication of any cut features into the natural sand underlying this deposit.

Work along the riverside revealed a dump of mixed soils, likely from the building of the latest extensions since finds were made of plastic and concrete. Work to the SE corner of the site revealed the area to be heavily disturbed by services (see figure 26) from the nearby houses and modern oil storage tank foundations of reinforced concrete. Work also revealed the top of the steps to the river aligned to the west but were not investigated as ground levels were to be raised in this area and further excavation was not required. A monitoring of piling works along the riverside edge revealed mixed modern deposits and traces of the garden soil noted to the southern edge of the site to a depth of 0.6m over natural sand continuing on a steep slope towards the river edge.

#### 7. Conclusions

Overall little or no archaeological remains of interest were revealed by the development work. No trace was made of the building named 'Bristol Cottage' to the south side of the site of the bakery as depicted on the 1<sup>st</sup> edition OS (see figure 4) though its outline is visible on the gable to the south.

It is possible that the redevelopment of the bakery especially in the removal and replacement of concrete floors has caused the removal of any archaeological deposits. It may also be possible due to the angle that the garden soil runs eastward to the river that any deposits of interest were situated at the west end of the site and therefore so much higher and were removed when the bakery was extended to the south in the late 19<sup>th</sup> century. It should be noted that the north wall line of nearby Constabulary Gardens to the south is considerably higher than to the development area.

That no earlier deposits than the early 19<sup>th</sup> century building or garden soils of a possible 18<sup>th</sup>/19<sup>th</sup> century were revealed may relate to the fact that it is recorded that the previous bridge of Nairn was washed away due to flooding and this area has seen subsequent flooding which may have caused quite an amount of erosion of ground prior to the retaining wall along the riverside being built.

#### 8. Recommendations

No recommendations with regard any further fieldwork for this project is to be proposed due to no features of interest being revealed, and no further work is required.

#### 9. Archive

The following is to be deposited in the National Monuments Record in Edinburgh:

- Notebook of results
- Black and white photographs & negatives
- Copy of this report

A set of black & white photographs of the building prior to demolition and a set of colour slides showing the progress of the work has been deposited with Highland Council Sites and Monuments Record. Digital images used in this report have been deposited with HSMR on disc as well as a copy of this report as a PDF file.

## 10. Discovery & Excavation in Scotland

A short summary of the results of this project will be submitted to the Council for Scottish Archaeology's publication *Discovery & Excavation in Scotland*.

#### 11. References

Bain, G (1903) History of Nairnshire. Telegraph Office. Nairn.

Barron, A (1999) Old Nairn. Stenlake Publishing. Ochiltree.

Census Returns for Nairn Parish 1841 – 1851.

County Valuation Rolls for the Burgh of Nairn 1867 – 1890.

Dennison, E P & Coleman, R (1999) Historic Nairn: the archaeological implications of development. Scottish Burgh Survey. Historic Scotland. Edinburgh.

Ellen, D M (1995) Nairn: Faces and Places. European Library. Holland.

Gifford, J (1992) The Buildings of Scotland: Highlands and Islands. Penguin. Edinburgh.

IFA (1999) By-laws, Standards and Policy Statements of the Institute of Field Archaeologists. Reading.

#### Maps Consulted

Ordnance Survey 1<sup>st</sup> edition 1:500 sheet 1.12.23 Nairn-shire of 1869.

Ordnance Survey 1<sup>st</sup> edition 1:2500 sheet 1.12 Nairn-shire of 1871 surveyed 1868.

Ordnance Survey 2<sup>nd</sup> edition 1:2500 sheet 1.12 Nairn-shire of 1905 revised 1904.

Ordnance Survey edition 1:2500 NH 8856 of 1964 revised 1963.

Ordnance Survey edition 1:2500 NH 8856 of 1972 revised 1963.

John Woods Plan of Nairn 1821.

Dallas' plan of Nairn nd.

Fraser's' plan of Nairn nd.

## Appendix 1 – Photographic Register

#### Black & White Photographs

- 1 View of frontage of building facing SE.
- 2 View of frontage of building.
- 3 View of frontage of building with former entrance.
- 4 View of frontage of building facing SW.
- 5 View of buildings from Bridge facing W.
- 6 View of steps down to river.
- 7 View of stairs from preparation area to 1<sup>st</sup> floor.
- 8 View of oven.
- 9 View of 2<sup>nd</sup> oven.
- 10 View of bakery facing W.
- 11 View of refrigeration unit.
- 12 View of preparation room facing W.
- 13 Detail of iron column scale 1m.
- 14 Detail of wrought iron banisters for rear stairs scale 1m.
- 15 View of demolition in progress at east end of building.
- 16 View of former sitting room 1<sup>st</sup> floor.
- 17 Detail of removed fireplace.
- 18 View of mid stairs from 1<sup>st</sup> floor to ground floor.
- 19 View of 1<sup>st</sup> floor above shop facing W. 20 View of 1<sup>st</sup> floor above shop facing E.
- 21 Detail of stairs above shop.
- 22 View of stairs down to shop.
- 23 View of rear stairs from 1<sup>st</sup> floor.
- 24 Detail of skylight.
- 25 View of 1<sup>st</sup> floor storage area facing W. 26 View of 1<sup>st</sup> floor storage area facing E.
- 27 Detail of roof vent.
- 28 View of alleyway to S of buildings facing W.
- 29 View of east range of building facing NW.
- 30 View of storage area and vent facing W.
- 31 View of rear of buildings facing N.
- 32 View of roof lines and vents facing W.
- 33 Detail of graffiti in attic.
- 34 Detail of graffiti in attic.
- 35 Detail of graffiti in attic.
- 36 Detail of graffiti in attic.
- 37 View of sign in attic storage space facing S.
- 38 View of attic storage space facing W.

#### Colour Slide - Film 1

- 1 View of frontage of building facing SE.
- 2 View of frontage of building.
- 3 View of frontage of building with former entrance.
- 4 View of frontage of building facing SW.
- 5 View of buildings from Bridge facing W.
- 6 View of steps down to river.
- 7 View of oven.
- 8 View of 2<sup>nd</sup> oven.
- 9 View of bakery facing W.
- 10 View of refrigeration unit scale 2m.
- 11 View of preparation room facing W.
- 12 Detail of iron column.
- 13 View of stairs from preparation area to 1<sup>st</sup> floor.
- 14 Detail of wrought iron banisters for rear stairs scale 1m.
- 15 View of demolition in progress at east end of building.
- 16 View of former sitting room 1<sup>st</sup> floor.
- 17 Detail of removed fireplace.

- 18 View of mid stairs from 1<sup>st</sup> floor to ground floor.
- 19 View of 1<sup>st</sup> floor above shop facing W. 20 View of 1<sup>st</sup> floor above shop facing E.
- 21 Detail of stairs above shop.
- 22 View of stairs down to shop.
- 23 View of 1st floor storage area facing E. 24 View of 1<sup>st</sup> floor storage area facing W.
- 25 Detail of skylight.
- 26 View of rear stairs from 1<sup>st</sup> floor.
- 27 View of attic storage space facing W.
- 28 View of sign in attic storage space facing S.
- 29 Detail of graffiti in attic.
- 30 Detail of graffiti in attic.
- 31 Detail of graffiti in attic.
- 32 Detail of graffiti in attic.
- 33 View of roof lines and vents facing W.
- 34 View of rear of buildings facing N.
- 35 View of roof lines and vents facing W.
- 36 View of east range of building facing NW.

#### Colour Slide - Film 2

- 1 View of alleyway to S of buildings facing W.
- 2 Detail of roof vent.
- 3 View of east side of building during demolition works.
- 4 View of building supports in bakery.
- 5 View of shop fittings.
- 6 Ibid.
- 7 View of front of shop showing alterations facing NE.
- 8 View of shop during demolition facing E.
- 9 View of imitation stone cladding in shop.
- 10 View of 1<sup>st</sup> floor above shop facing W upon removal of plasterwork.
- 11 Detail of fireplace west wall 1st floor.
- 12 View of fireplace 1<sup>st</sup> floor central room facing NW.
- 13 ibid with recessed cupboard to NW.
- 14 Detail of fireplace 1<sup>st</sup> floor central room facing NW scale 1m.
- 15 ibid with recessed cupboard to NW.
- 16 Detail of fireplace 1<sup>st</sup> floor central room facing W scale 1m.
- 17 Detail of removed fireplace 1<sup>st</sup> floor scale 1m.
- 18 Gable end of east range.
- 19 View of demolition in progress at east end.
- 20 View of demolition in progress at east end.
- 21 View of demolition in progress at north west corner.
- 22 View of demolition in progress at north west corner.
- 23 View of demolition in progress at east end.
- 24 View of demolition in progress at northwest corner showing roof trusses.
- 25 View of demolition in progress at rear of buildings facing west.
- 26 View of rear of building facing north.
- 27 Detail of rear entrance at south side of bakery.
- 28 View of shop area during demolition facing W.
- 29 View of bakery range during demolition facing SW.
- 30 View of chimney to rear of building facing NW.
- 31 View of rear of building during demolition facing NE.
- 32 Detail of rear of building.
- 33 View of demolition in progress facing NW.
- 34 View of site facing west during demolition.
- 35 View of rear of north buildings during demolition.
- 36 View of demolition in progress at east end.

#### Colour Slide - Film 3

- 1 View of site upon demolition facing W.
- 2 View of site upon demolition facing W.
- 3 View of site upon demolition facing E.
- 4 View of site of cellar upon demolition facing NE.
- 5 View of site upon demolition facing E.
- 6 View of removal of concrete floor facing E.
- 7 View of removal of polystyrene under refrigeration unit facing W.
- 8 View of site upon demolition facing W.
- 9 View of south side of site upon demolition facing W.
- 10 Ibid.
- 11 View of SE corner upon demolition facing SE.
- 12 View of SE corner upon demolition facing NE.
- 13 View of east side of site upon demolition facing S.
- 14 Ibid but facing N.
- 15 Detail of path to southern edge of site facing S.
- 16 Detail of path to southern edge of site facing S scale 1m.
- 17 View of site upon cleaning facing NW.
- 18 View of east end site upon removal of topsoil facing N.
- 19 View of east end site upon removal of topsoil facing S.
- 20 Detail of natural to N edge at east end of site.
- 21 View of site upon cleaning facing W.
- 22 View of small test pit in garden soil facing S.
- 23 Detail of small test pit in garden soil facing S.
- 24 Detail of gable end to house to S showing ridge line of former building.
- 25 View of test pit for percolation.
- 26 Detail of section of trench through garden soil facing W scales 1m.
- 27 Ibid.
- 28 Detail of section of trench through garden soil facing SW scales 1m.
- 29 Detail of section of trench through garden soil facing S scales 1m.
- 30 Ibid.
- 31 Ibid.
- 32 Detail of section of trench through garden soil facing N scale 1m.
- 33 View of trench facing NE scales 1m.
- 34 View of trench facing NW scales 1m.
- 35 Ibid
- 36 View of trench facing W scales 1m.

#### Colour Slide - Film 4

- 1 View of trench facing W scales 1m.
- 2 Detail of section of trench through garden soil facing S.
- 3 View of site upon completion facing W.
- 4 View of natural ground to east end of site facing NW.
- 5 View of natural ground to east end of site facing N.
- 6 View of natural ground to east end of site facing W.

#### **Digital Images**

- 1 View of NE corner showing shop.
- 2 View of shop facing SW.
- 3 View of E range prior to demolition facing W.
- 4 View of steps to river.
- 5 Details of oven 1.
- 6 View of oven 2.
- 7 Detail of cast-iron banisters to rear of ground floor.
- 8 View of remove fireplace 1<sup>st</sup> floor scale 1m.
- 9 Detail of banisters to coffee shop 1st floor c1950's.
- 10 View of coffee shop/later bakery 1<sup>st</sup> floor facing E.

- 11 View of attic bedroom facing W.
- 12 Detail of graffiti on attic wall.
- 13 Detail of graffiti on attic door.
- 14 View of E range facing N.
  15 Detail of excavation for foundations facing S scales 1m.
  16 Detail of fireplace on 1<sup>st</sup> floor facing W scale 1m.
- 17 View of site upon clearance facing W.
- 18 View of garden soil to south side of site.
- 19 View of access point upon excavation facing N.
- 20 View of removal of concrete floors during demolition facing E.

## Appendix 2 – County Valuation Rolls 1855-1890

A periodic search of the Burgh County Valuation Rolls revealed the following:

A periodic search of the burgh County valuation Rolls revealed the following.			
1855-56 3 Bridge Street 5 Bridge Street	House House & Shop	Owner - Late David Falconer Owner – Late Arthur Cant of Lodgehill Tenant – Alexander McGillivray	
1860-63 1-4 Bridge Street 5 Bridge Street	Shop & Bakehouse House & Shop	Ann McGlashan Tenant - Alexander McGillivray	Rent £14 Rent £11
1864-65 1-4 Bridge Street 5 Bridge Street	Shop & Bakehouse House & Shop	Ann McGlashan Tenant – G Mackintosh	Rent £14 Rent £11
1866-67 1-3 Bridge Street 5 Bridge Street	Shop & Bakehouse House & Shop	Donald Grant Cameron Brothers, Fleshers	Rent £14 Rent £18
5 Bridge Street	Shop & Bakehouse in 1872 and noted with st Shop & House House ise of J McKenzie, groce	Cameron Brothers James Henderson, shoemaker	Rent £14
Rent rising to £30	Shop & Bakehouse in 1880 also acquired 7 E as having 5 Bridge Stre	Bridge Street in 1880.	Rent £14
1890 1 Bridge Street (Owned by J Ashe 3 & 5 Bridge Street	Śhop & Stores Bakehouse & Store	Tenant G McKenzie, grocer Owner – J Asher Owner – J Asher	Rent £25 Rent £20 Rent £8
•			

## Appendix 3 – Census Returns 1841-1851

#### 1841

Bridge Street - No house numbers given.

1 - Alexander Falconer 95

Robert Falconer 45 cooper

1 - Catherine Falconer 55

John Cuthbert 40 slater

1- Elizabeth Falconer 55 Innkeeper

Jane Falconer 20

Elizabeth McTrail 20 Servant

#### 1851

Copy not very clear.

1 Bridge Street?

Robert Falconer 60 Master cooper Katherine Falconer 45 Housekeeper

Alexr Simpson 29 Blacksmith journeyman

Katherine Simpson 28 Alister Simpson 8m

3 Bridge Street?

Elizabeth Falconer 65 Innkeeper

5 Bridge Street

Alexr McGillivray 50 Saddler employing 4

Margt McGillivray 44 Wife

John McGillivray 14 Saddler apprentice

Jane McGillivray 13 Daughter
Hugh McGillivray 10 Son – Scholar
Farquhar McGillivray 8 Son – Scholar
Anne McGillivray 8 Daughter

Alexr Mackintosh 19 Saddler – journeyman Andrew McKenzie 16 Saddler – apprentice

Margt Cumming 19 Servant